



X:\Projects\611-ODOT-IDL North & South Bound Lanes\DWG\Sheets\611-BRIDGE_15A\SHEETS\611-SB-BR15A-WING REPAIR 01.dwg, 3/25/2016 8:18:01 AM, DEP

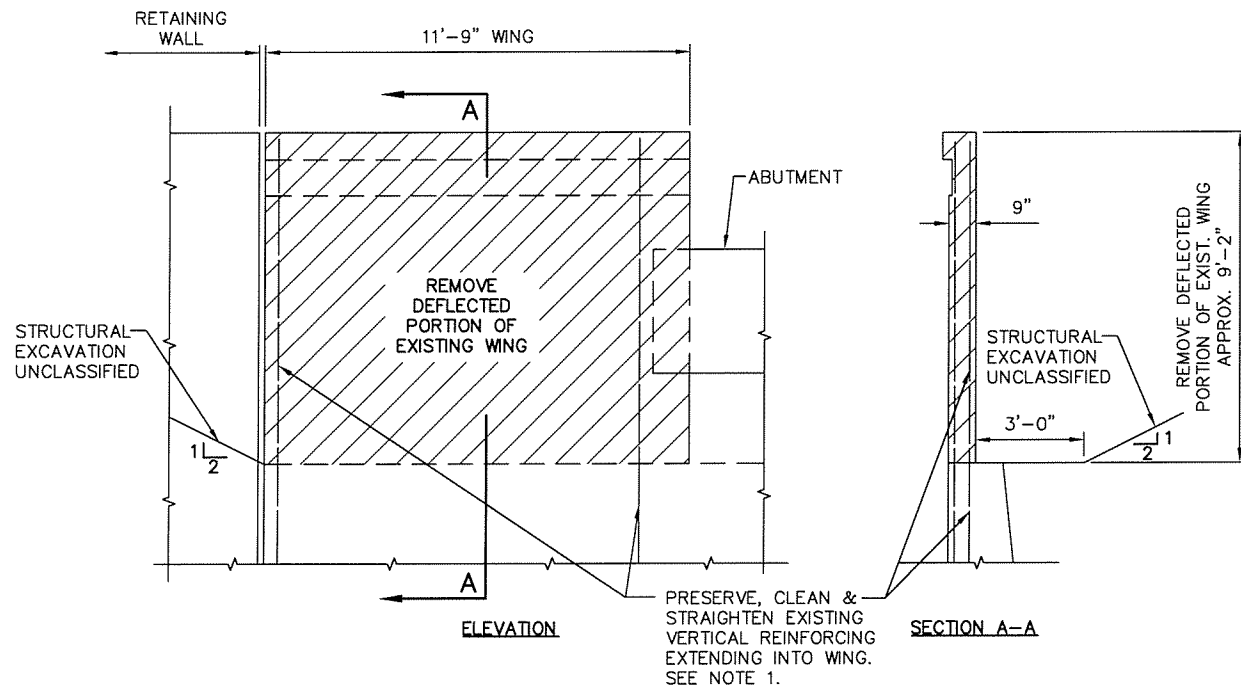


DETAILS OF EXISTING WING REMOVAL

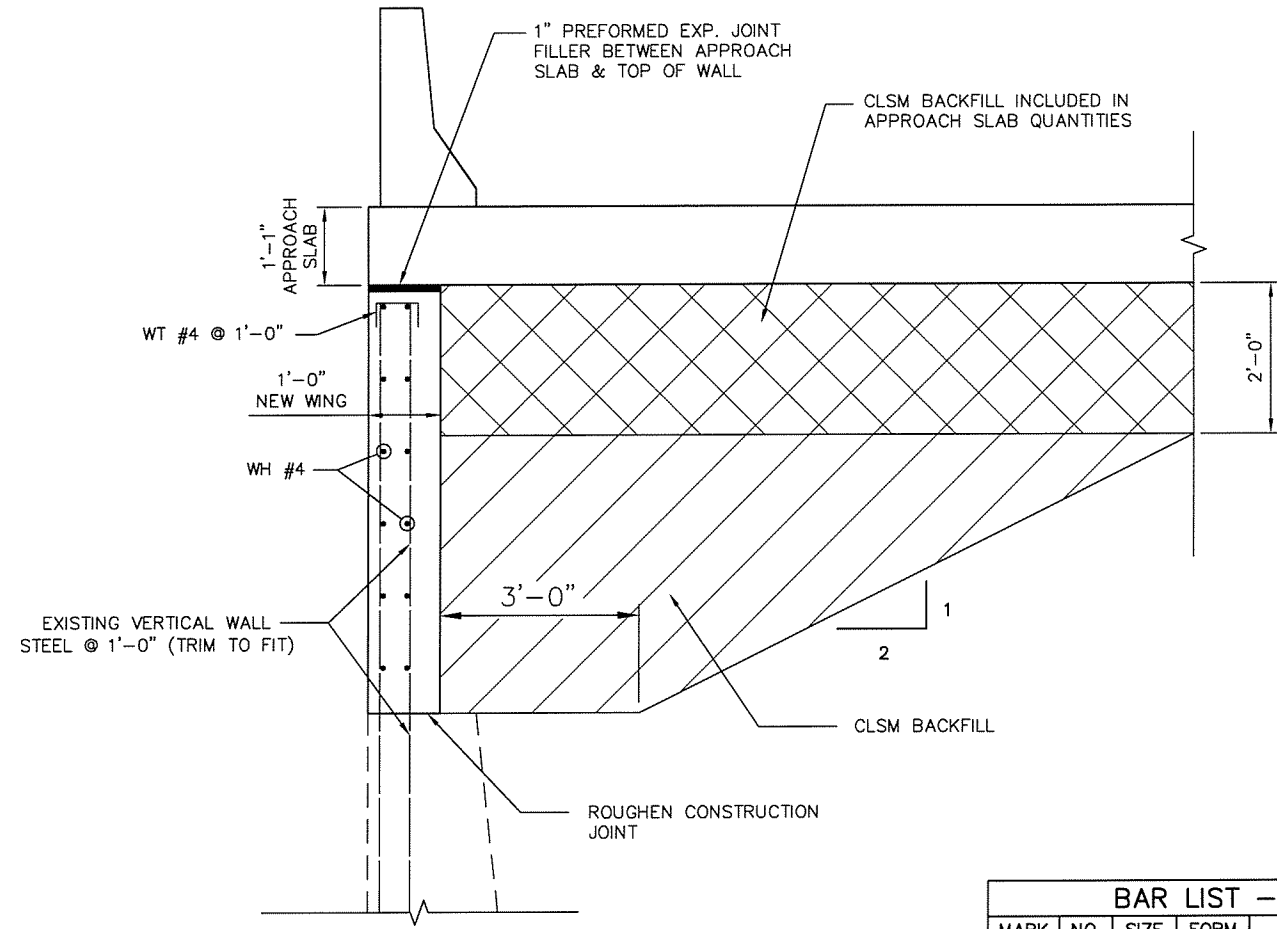


SECTION THROUGH WING

NOTE 1:
 ANY DAMAGE TO THE EXISTING REINFORCING STEEL SHALL BE REPAIRED AT THE CONTRACTORS EXPENSE. ANY DETERIORATED REINFORCING STEEL WITH SECTION LOSS GREATER THAN 50% SHALL BE REPORTED TO THE BRIDGE ENGINEER FOR REMEDIAL ACTION.


BAR LIST - WING REPAIR					
MARK	NO.	SIZE	FORM	LENGTH	LENGTH VARIATION
EPOXY COATED					
WH	12	#4	STR.	11'-5"	
WT	13	#4	BNT.	1'-5"	

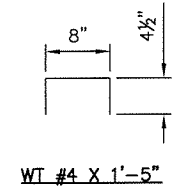

DETAILS OF BENT REINFORCEMENT

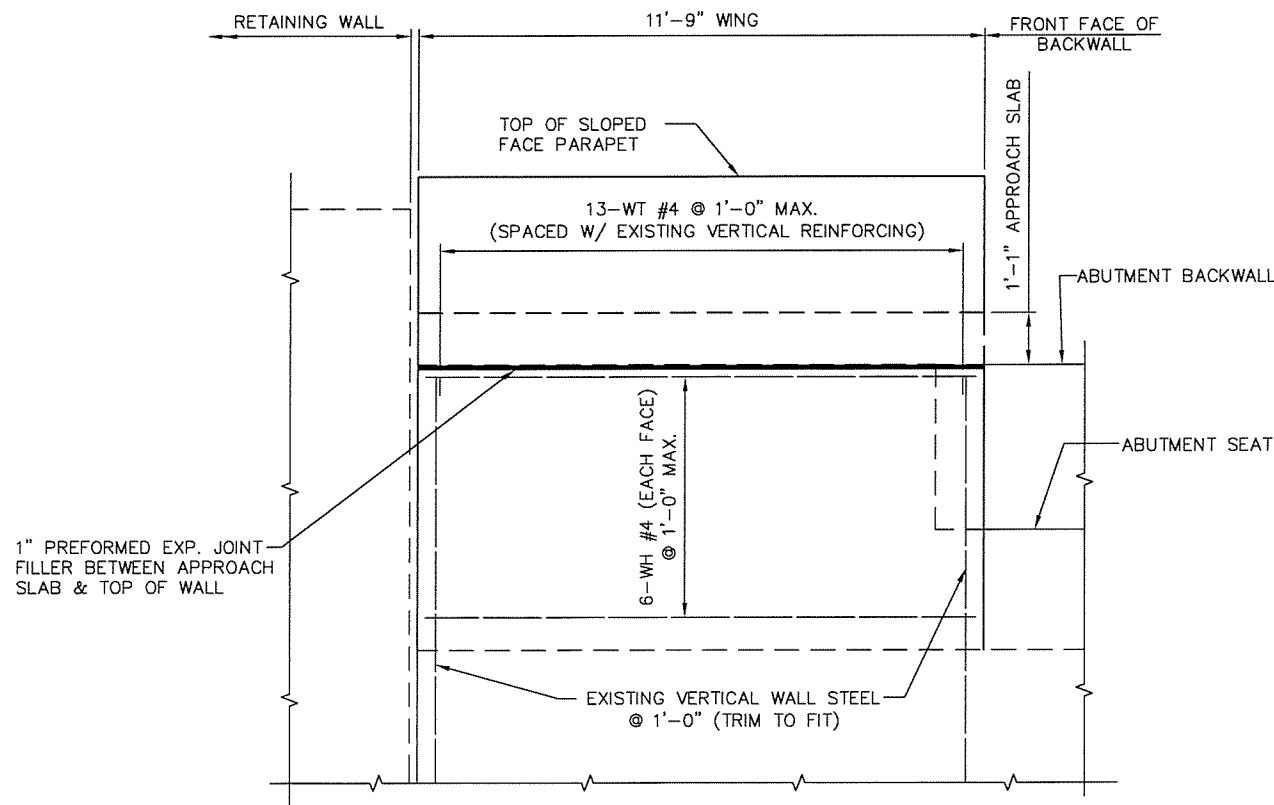

ELEVATION

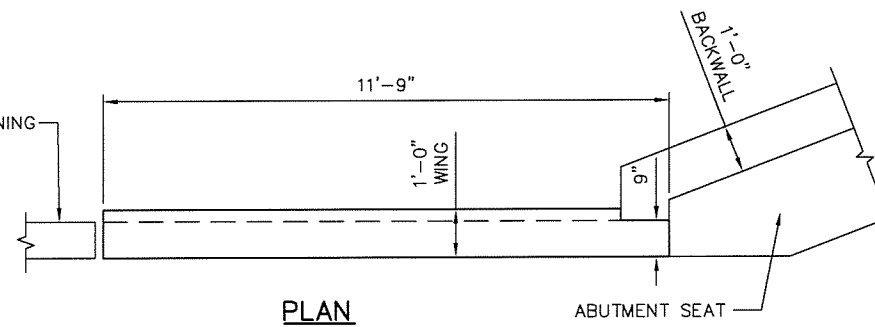

PLAN

ESTIMATED QUANTITIES		
ITEM	UNIT	TOTAL
STRUCTURAL EXCAVATION UNCLASSIFIED	CY	22.00
CLSM BACKFILL	CY	22.00
CLASS A CONCRETE	CY	3.00
EPOXY COATED REINFORCING STEEL	LB	104.00

DESIGN	SJN	01/09	BRIDGE A	TULSA COUNTY
DRAWN	GMN	01/09	DETAILS OF WING REPAIR	
CHECKED	SAL	01/09		
APPROVED				
SQUAD	BKJ			
			STATE JOB PIECE NO. 28880(04)	SHEET NO. 14