
1/4 CORNER B-7-639 FOUND 1.5" PIPE AS DESCRIBED ON CCR FILED MARCH 26, 2007, BY ROBBY L. JOHNSON, PLS 1539. POSITION OF THIS PIPE FITS NUMEROUS MONUMENTS FOUND AT LOT CORNERS IN TWINOAKS ADDITION TO DURANT, OK, ACCORDING TO THE RECORDED PLAT THEREOF, SURVEYED AND SIGNED BY T.B. MATTHEWS ON MARCH 16, 1926. FOUND A PK NAIL WITH TAG MARKED PLS 1165 AS FILED BY DAVID PAGE, JR. AS THE SOUTH 1/4 CORNER OF SECTION 20 ON MARCH 26 2007, 14.5' SOUTH AND 10.6' WEST OF PIPE. PK NAIL POSITION IS CLOSE TO BEING AT MIDPOINT BETWEEN SECTION CORNER MONUMENTS ONE-HALF MILE EAST AND ONE-HALF MILE WEST. ACCEPTED POSITION OF 1.5" PIPE AS MOST NEARLY REPRESENTING ORIGINAL POSITION OF CORNER, AND SET 80D SPIKE WITH WASHER MARKED "ODOT PLS 1561" AS ENDORSEMENT.

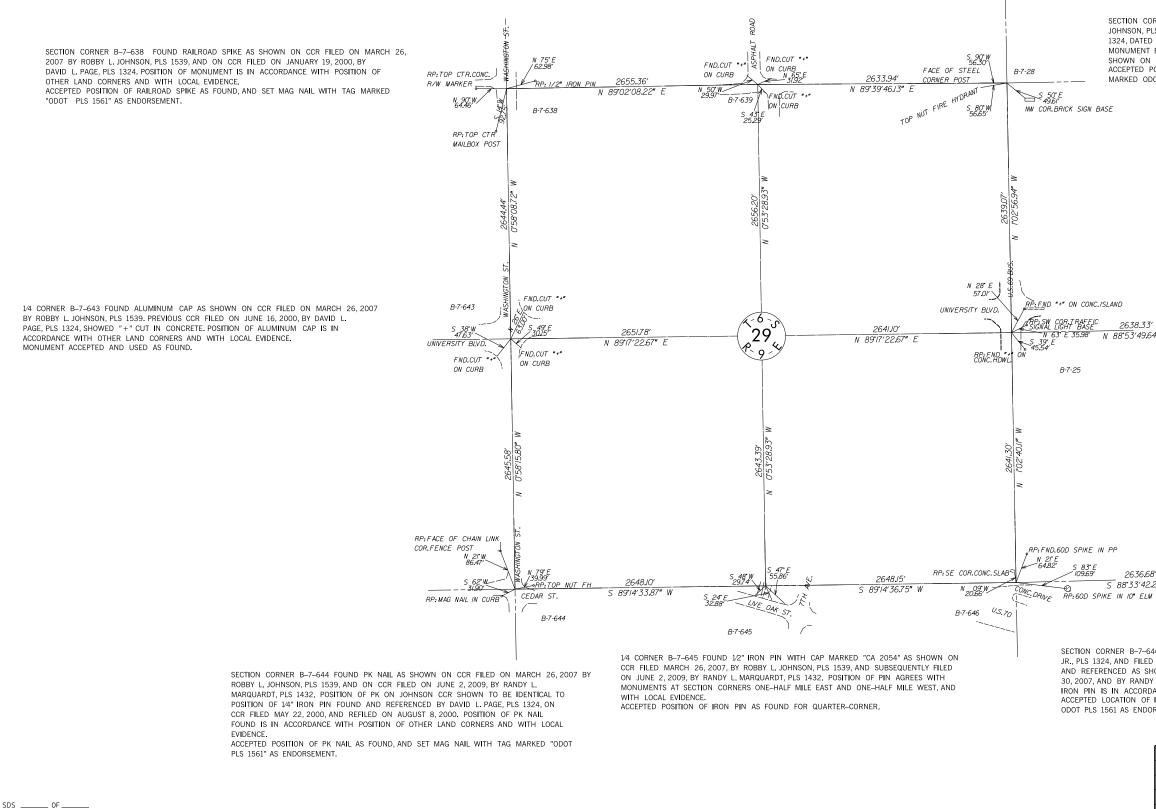

OKLAHOMA DEPARTMENT OF TRANSPORTATION						
FED. ROAD DIST. NO.	STATE	JOB PIECE NO.	FISCAL YEAR	SHEET NO.	TOTAL SHEETS	
6	OKLA.					
DESCRIPTIO			DATE			

SECTION CORNER B-7-28 FOUND PK NAIL PER REFERENCES ON CCR FILED BY ROBBY L. JOHNSON, PLS 1539, DATED MARCH 30, 2007, AND ON CCR FILED BY DAVID PAGE, PLS 1324, DATED SEPTEMBER 5, 2000, POSITION AGREES WITH O.H.D. STANDARD BRASS MONUMENT ESTABLISHED UNDER SW02834(1) BY RAY N SEELEY, ODOT LOCATION ENGINEER, SHOWN ON FORM SD-11 DATED SEPTEMBER 20, 1968. ACCEPTED POSITION OF PK NAIL AS FOUND. REPLACED WITH MAG NAIL WITH WASHER MARKED ODOT PLS 1561.

2638.33 N 88°53′49.64" E

1/4 CORNER B-7-25 FOUND PK NAIL PER REFERENCES ON CCR FILED BY ROBBY L. JOHNSON, PLS 1539, DATED MARCH 30, 2007, AND PREVIOUS CCR FILED BY DAVID PAGE, LS 1324, DATED SEPTEMBER 5, 2000. POSITION AGREES WITH O.H.D. STANDARD BRASS MONUMENT SET BY RAY N. SEELEY, ODOT LOCATION ENGINEER, ESTABLISHED UNDER SW02834(1) AND SHOWN ON FORM SD-11, DATED SEPTEMBER 20.1968. ACCEPTED POSITION OF PK NAIL AS FOUND. REPLACED WITH MAG NAIL WITH WASHER MARKED ODOT PLS 1561.

2636.68′ S 88°33′42.28″ W

SECTION CORNER B-7-646 FOUND 3/8" IRON PIN SHOWN ON CCR AS SET BY DAVID PAGE, JR., PLS 1324, AND FILED ON JANUARY 19, 2005. PIN WAS SUBSEQUENTLY RECOVERED AND REFERENCED AS SHOWN ON CCRS FILED BY ROBBY L. JOHNSON, PLS 1539, ON MARCH 30, 2007, AND BY RANDY L. MARQUARDT, PLS 1432, ON JUNE 2, 2009. POSITION OF IRON PIN IS IN ACCORDANCE WITH SURROUNDING MONUMENTS AND WITH LOCAL EVIDENCE. ACCEPTED LOCATION OF IRON PIN AS FOUND, AND SET 60D SPIKE WITH WASHER MARKED ODOT PLS 1561 AS ENDORSEMENT.

PLS		OKLAHOMA DEPARTMENT OF TRANSPORTATION SURVEY DIVISION				
DRAWN						
CHECKED		SURVEY DATA SHEET				
APPROVED						
CREW		SWO <u>48//</u> (/) PROJECT NO. <u>279/2(04)</u> SHEET NO. <u>SOO8</u>				

BRYAN CO. SH-78