

OKLAHOMA DEPARTMENT OF TRANSPORTATION				
FED. ROAD DIST. NO.	STATE	PROJ. NO.	FISCAL YEAR	TOTAL SHEETS
	OKLA.			
DESCRIPTION		REVISIONS	DATE	

SECTION CORNER
ODOT MON. NO.
P-64-532
FOUND 1/2" IRON PIN SET BY PARTIES UNKNOWN, AGREES WITH EXISTING IDENTIFIED CORNERS IN THE AREA, PLACED PLASTIC ID CAP STAMPED ODOT PLS 1198 ON PIN AND USED AS FOUND.

1/4 CORNER
ODOT MON. NO.
P-64-531
FOUND 3/4" PIPE INPLACE THIS MONUMENT FILED BY: G. W. DENNY IN 1986, W. KEY 1999, PLACED BRASS CAP STAMPED 1/4 COR. ODOT PLS 1198 INSIDE PIPE AND USED AS FOUND.

ALL R.P.'S ARE 1/2" X 1/2" IRON PINS UNLESS OTHERWISE NOTED.


1/4 CORNER
ODOT MON. NO.
P-64-534
SET 1/2" IRON PIN AND PLASTIC ID CAP STAMPED ODOT PLS 1198 AT MIDPOINT BETWEEN PREVIOUSLY ESTABLISHED SECTION CORNERS EAST AND WEST.

SECTION CORNER
ODOT MON. NO.
P-64-535
THIS CORNER SET PROPORTIONATE DISTANCE FROM ORIG. STONE 1 MI. NORTH AND 1-1/2" PIPE 1 MI. SOUTH AND 3/8" IRON PIN 1 MI. WEST AND PREVIOUSLY ESTABLISHED SECTION COR. 1 MI. EAST.


SECTION CORNER
ODOT MON. NO.
P-64-533
FOUND 3/8" I.P. INPLACE, LONG USED BY LOCAL SURVEYORS AGREES WITH IDENTIFIED EXISTING CORNER IN THE AREA REPLACED 3/8" IRON PIN WITH 1/2" IRON PIN AND PLASTIC ID CAP STAMPED ODOT PLS 1198

1/4 CORNER
ODOT MON. NO.
P-64-530
SET 2" MAG NAIL AND WASHER STAMPED ODOT PLS 1198 AT MIDPOINT BETWEEN PREVIOUSLY ESTABLISHED SECTION CORNERS NORTH AND SOUTH.

FOUND ORIGINAL 3" PIPE AND BRASS CAP TOWNSHIP CORNER INPLACE IN GOOD CONDITION

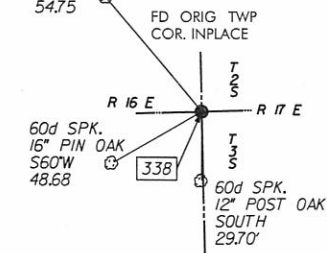

TOWNSHIP CORNER
ODOT MON. NO.
P-64-529
FOUND ORIGINAL 3" PIPE AND BRASS CAP TOWNSHIP CORNER INPLACE IN GOOD CONDITION

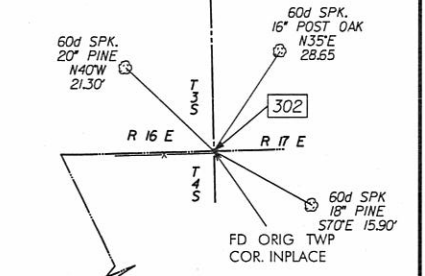

1/4 CORNER
ODOT MON. NO.
P-64-527
SET 1/2" IRON PIN AND PLASTIC ID CAP STAMPED ODOT PLS 1198 AT MIDPOINT BETWEEN PREVIOUSLY ESTABLISHED SECTION CORNERS EAST AND WEST.

SECTION CORNER
ODOT MON. NO.
P-64-528
FOUND 1-1/2" IRON PIPE 2" DEEP INPLACE, LONG USED BY LOCAL SURVEYORS AGREES WITH IDENTIFIED EXISTING CORNERS IN THE AREA, FITS FENCES, PLACED 1/2" IRON PIN AND PLASTIC ID CAP STAMPED ODOT PLS 1198 ON TOP OF PIPE AT GRADE.

SECTION CORNER
ODOT MON. NO.
P-64-184
FOUND 1/2" IRON PIN INPLACE, THIS CORNER ESTABLISHED UNDER SW03068 BY ROY SISK, FOUND 1 ORIG. RP, REPLACED 1/2" I.P. WITH ODOT STD. FENO MARKER W/BRASS CAP STAMPED SEC. COR. ODOT PLS 1198
FOUND 3/4" IRON PIN 12.7' SOUTH AND 6' WEST SET BY PARTIES UNKNOWN.

1/4 CORNER
ODOT MON. NO.
P-64-525
FOUND 3/8" IRON PIN W/ID CAP, THIS MONUMENT SET AND CERTIFIED BY ED KELLOG IN 1979, RE-FILED BY G. W. DENNY IN 1986 VERIFIED W/ EXIST. R.P.S, REPLACED 3/8" IRON PIN W/ 1/2" IRON PIN AND PLASTIC ID CAP STAMPED ODOT PLS 1198.

SECTION CORNER
ODOT MON. NO.
P-64-526
FOUND 1/2" IRON PIN INPLACE LONG USED BY LOCAL SURVEYORS FITS SINGLE PRORATION TO ORIG. TOWNSHIP CORNER EAST AND ORIG. STONE PLACED PLASTIC ID CAP STAMPED ODOT PLS 1198 ON PIN AND USED AS FOUND.

SDS _____ OF _____

1/4 Corner
ODOT Mon. No. P-64-182
Found Original Stone
Inplace, no marks found.



PLS	
DRAWN	
CHECKED	
APPROVED	
CREW	

OKLAHOMA DEPARTMENT OF TRANSPORTATION
SURVEY DIVISION

SURVEY DATA SHEET

SWO _____ () PROJECT NO. 26346(04) SHEET NO. 78