OKLAHOMA DEPARTMENT OF TRANSPORTATION FED. ROAD DIST. NO. STATE PROJ. NO. FISCAL SHEET TOTAL YEAR NO. SHEETS OKLA.

1/4 Section Corner - O.D.O.T. T-72-1432 - Found and accepted a 3/8" Iron Pin as referenced by Tom A. Haynes RPLS #1052 on August 9, 2001. Found three (3) references to the said 3/8" Iron Section Corner - 0.D.O.T. T-72-1433 - Found and accepted a 5/8" Iron Pin referenced by Randy L. Pin set by Cline L. Mansur RPLS #241 circa November 26, 2001. Marquardt RPLS #1432 on February 2nd, 2005 with one matching reference. Set two (2) more references for 3/8" Iron Pin With Cap / NOF41'29"W I672' the corner record. Power Pole NI8"35'20" E

102.28

-(9000)

5/8" Iron Pin<sub>15</sub>

Power Pole S4l\*57'3!" E 47.32'

Railroad Spike In

E.Pine St.


Railroad Spike In

Corner Fence Post S45'44'45"W

4' Barbwire Fence

Section Corner - 0.D.O.T. R-66-1073 - Found and accepted a 5/8" Iron Pin with cap "ODOT PLS 1563" in a 1" Pipe along with 4 references filed by several surveyor's, The most recent being referenced by Jeffrey Arthur Tuttle, RPLS #1094 on March 15, 2011 and Michael W. Fisher, RPLS #1563 on October 18,

1/4 Section Corner - O.D.O.T. T-72-1435 -Found and accepted a 3/8" Iron Pin with cap "White RPLS 1052" last referenced by Randy L. Marquardt RPLS #1432 on February 3, 2005 and found several matching references set by others.

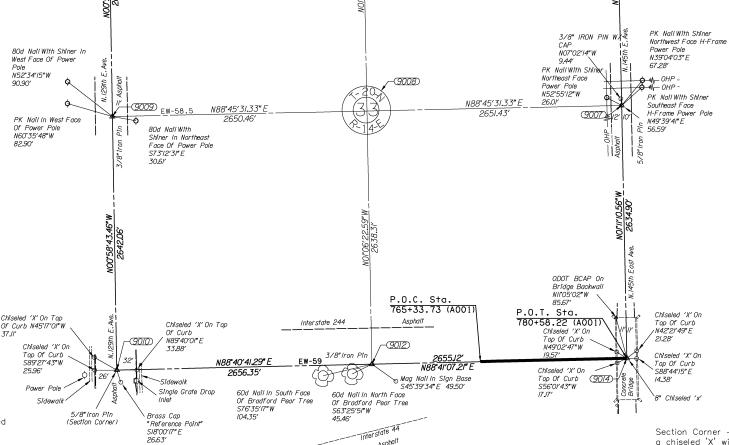

~900D

3/8" Iron Pi

S29°41'13" E

32.82

60d Nall In North Face Of Fence Post

E.Pine St. 16'

60d Naîl In East

Face Of Power Pole SI5\*56'07"W 26.57'

Fence

Telephone Vault

PK Nati In Power Pole N67°27′42″W 59.97′

(9002)

Mag Nail In Power Pole SI5\*07'58"W

8813'

Mag Nail In Power Pole S76'02'00" E

92.31

`Fire Hydrant

. Mag Nail In Power Pole SI8\*I0'39" E 75.05'

> 1/4 Section Corner - O.D.O.T. R-66-1071 -Found and accepted a 5/8" Iron Pin set and referenced by Michael W. Fisher, RPLS 1563 on October 22, 2007. Corner references from the SWO 3426(1) survey records performed by Mr. L.E. Higginbotham in 1979 were used to verify this position by Mr. Fisher. Found three (3) of five (5) of Mr. Fisher's references. Found and rejected a 3/8" iron pin with cap as set and referenced by Tom A. Haynes. Mr. Haynes gave no reason why he chose to reject the 5/8" found Iron Pin in favor of a position determined by single proportion measurement.

Section Corner - O.D.O.T. T-72-1431 - Found and accepted a 5/8" Iron Pin originally set and referenced by J. Wesley Bills RPLS #1135 on July 22, 1997 and referenced by several others. Found several previous corner references from previous corner records.

> 1/4 Section Corner - 0.D.O.T. T-72-1434 - Found and accepted a  $3/8^{\prime\prime}$  Iron Pin with cap stamped "White RPLS 1052" set and reference by Tom A. Haynes RPLS #1052 on August 9th, 2001. Found one matching reference and set two (2) more.

Asphalt

Section Corner - O.D.O.T. R-66-1069 - Found and accepted a chiseled 'X' with a 1 1/4" bolt along with five (5) references as referenced last by Michael W. Fisher RPLS #1563 on October 18, 2007. This position was originally filed by Mr. L.E. Higginbotham, RPLS #84 in the SWO 3426(1) Survey records from 1979.



NOTE: REFERENCE'S SHOWN ARE NOT TO SCALE.

OKLAHOMA DEPARTMENT OF TRANSPORTATION PLS SURVEY DIVISION DRAWN CHECKED AKE **SURVEY DATA SHEET** PPROVED GAA CREW CHOUTEAU SWO 4707 (2) PROJECT NO. 21899(04) SHEET NO. S-14